

Piezoelectric pressure sensor

Type 601C...

for Test & Measurement applications

The miniature pressure sensors of the Type 601C series are, due to their high sensitivity, suited for a variety of applications where very small pressure pulsations need to be measured. In addition, the optimized diaphragm ensures accurate dynamic pressure measurements, even when the diaphragm is simultaneously exposed to a high thermal shock.

- Pressure range up to 250 bar (3 626 psi)
- · High sensitivity
- Membrane optimized for high thermal shocks
- Small sensor size
- Short rise time & high natural frequency
- Extremely wide operating temperature range
- Charge (PE) or Voltage (IEPE) output

Description


Due to their high natural frequencies, piezoelectric pressure sensors can be used for a variety of applications where dynamic pressures need to be measured. Another unique characteristic of piezoelectric pressure sensors is their ability to measure small pressure fluctuations that are superimposed on top of high static pressures with exceptional resolution. By contrast, piezoresistive pressure sensors are the right choice when measuring static pressure curves.

At the core of the all-welded, hermetically sealed Type 601C series there is a high performance PiezoStar crystal grown by Kistler. This PiezoStar crystal gives the sensor a far higher sensitivity than an equivalently sized pressure sensor based on synthetic Quartz, which results in a lower noise level and so enables lower pressure to be measured more accurately.

The pressure to be measured acts on the sensor's diaphragm and compresses the PiezoStar crystal. The compressed crystal produces a charge which is proportional to the pressure. Finally, the charge signal needs to be converted, by a charge amplifier, into a voltage which can then be read.

Typical applications

- Pressure pulsations on compressors, pumps, turbines, propellers, etc.
- Dynamic pressure measurements with high thermal shocks as for example gas and dust explosions (Ex testing), pyrotechnical devices, closed vessel testing, energetic material testing, sloshing or small dynamic pressures as for example sound pressure, etc.

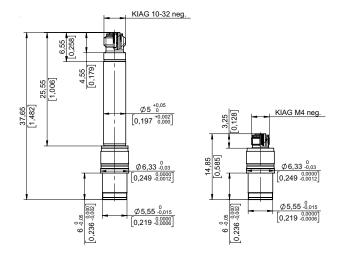

Charge (PE) vs. Voltage (IEPE) output

One of the most important selection criteria for piezoelectric pressure sensors is the output signal. Two variants of the sensor are available, charge output (PE) and voltage output (IEPE resp. Piezotron).

Piezoelectric pressure sensors are connected to an electronic circuit which converts the charge generated by the sensor into a proportional voltage. If the electronic circuit is integrated into the sensor housing, it is referred to as an IEPE sensor. If the electronics is an external device (charge amplifier), it is referred to as a PE sensor. Depending on the application, PE or IEPE sensors may be better suitable.

IEPE sensors are the ideal solution for the long-term measurement of small pressure pulsations (without any static pressure content) or the measurement of dynamic pressure profiles (up to a few tenths of a millisecond only). IEPE sensors will however, due to the built-in electronics, only work at moderate temperatures and come with a fixed measuring range.

PE sensors on the other hand are the right solution for the long-term measurement of small pressure pulsations (without any static pressure content), quasi-static or dynamic pressure profiles (up to a few minutes). PE sensors will, due to the external charge amplifier, operate at extreme temperatures too and allow for adjustable measuring ranges.

The instruction manual and pressure catalogue provides further details on PE and IEPE sensors, measuring chains as well as applications each technology is best suited for.

Page 1/7



Technical data - PE sensors 1)

Type 601CA...

| | рC | Charge (PE) |
|-----------------------------|--------|---|
| Pressure range | | |
| | psi | 0 3 626 |
| Calibrated partial range | | |
| | bar | 300 |
| | psi | 4 350 |
| (nom.) | pC/bar | -37.0 |
| | pC/psi | -2.6 |
| (typ.) | %FSO | ≤±0.1 |
| | %FSO | ≤±0.3 |
| Operating temperature range | | |
| | °F | -321 +662 |
| | (typ.) | bar psi % bar psi (nom.) pC/bar pC/psi (typ.) %FSO %FSO ge °C |

| Rise time (10 90%) | μs | <1.4 |
|--|---------------------|-------------------|
| Natural frequency 2) | kHz | >215 |
| Noise (1 Hz 10 kHz) (typ.) | µbar _{rms} | 15 |
| Acceleration sensitivity (axial) (typ.) | bar/g | 0.0020 |
| | psi/g | 0.0290 |
| Acceleration sensitivity (radial) (typ.) | bar/g | 0.0001 |
| | psi/g | 0.0015 |
| Insulation resistance | Ω | ≥10 ¹³ |
| Weight Type 601CAA / 601CAB | gram | 4.5/1.9 |
| Housing and diaphragm material | 17-4 S.S. | |

Technical data - IEPE sensors 1)

| Type 601CBA | | | 00001.5 | 00003.5 | 00007.0 | 00014.0 | 00035.0 | 00070.0 | 00250.0 |
|--|---------|---------------------|----------------|-------------|---------|-------------|---------|---------|---------|
| Output signal | | V | Voltage (IEPE) | | | | | | |
| Pressure range | | bar | 1.5 | 3.5 | 7 | 14 | 35 | 70 | 250 |
| | | psi | 22 | 50 | 100 | 200 | 500 | 1 000 | 3 626 |
| Maximum pressure | | bar / psi | | | | 250 / 3 626 | | | |
| Overload | | bar / psi | | | | 300 / 4 350 | | | |
| Sensitivity | (nom.) | mV/bar | 3 333 | 1 429 | 714 | 357 | 143 | 71 | 20 |
| | | mV/psi | 230 | 99 | 49 | 25 | 9.9 | 4.9 | 1.4 |
| Linearity | | %FSO | ≤±1.0 | | | | | | |
| Operating temperature ran | ige | °C / °F | | | -55 | +120 / -67 | . +248 | | |
| Rise time (10 90%) | | μs | <1.4 | | | | | | |
| Natural frequency 2) | | kHz | >215 | | | | | | |
| Time constant | (nom.) | S | 2 3 | | | | | | |
| Low frequency response | -3 dB | Hz | 0.080 0.053 | | | | | | |
| | -5% | Hz | 0.242 | 0.242 0.161 | | | | | |
| Noise (1 Hz 10 kHz) | (typ.) | µbar _{rms} | 3.5 | 8 | 16 | 32 | 79 | 160 | 567 |
| Acceleration sensitivity (axial) (typ.) | | bar/g | 0.0020 | | | | | | |
| | | psi/g | 0.0290 | | | | | | |
| Acceleration sensitivity (radial) (typ.) bar/g | | bar/g | 0.0001 | | | | | | |
| | | psi/g | 0.0015 | | | | | | |
| Supply voltage (by IEPE-Co | oupler) | VDC | 22 30 | | | | | | |
| Supply current (by IEPE-Co | upler) | mA | 2 20 | | | | | | |
| Output bias voltage | (nom.) | VDC | 11 | | | | | | |
| Output voltage FSO | | V | ±5 | | | | | | |
| Weight | | gram | 3.6 | | | | | | |
| Housing and diaphragm ma | aterial | _ | 17-4 S.S. | | | | | | |

¹⁾ Indications are valid for 23°C / 73°F (if not specified otherwise)

²⁾ Calculated from rise time



Mounting (sensors with standard housing)


Sensors with charge output (PE) and voltage output (IEPE) are available with standard housing. Sensors with a standard housing can either be installed directly or with an adapter.

Direct Mounting

When the mounting location space is restricted, the sensor can be located in an appropriately dimensioned mounting bore, and then held in place with a floating clamp nut. Please note that for a reliable and accurate pressure measurement a precise machining of the mounting hole with special reamers and taps is required. For details on mounting hole fabrication please check the manual.

Adapter Mounting

Fitting sensors into a mounting adapter greatly simplifies the installation process (when space and wall thickness are not a premium). Use of a Kistler mounting adapter will eliminate the need to provide a precise mounting configuration and allow the installer to provide only a threaded hole of the size and depth required for the adapter selected. Special reamers or taps are not required when using an adapter. For details on mounting thread fabrication please check the manual. All sensors and adapters are available for download as 3D CAD files from Kistler's webpage.

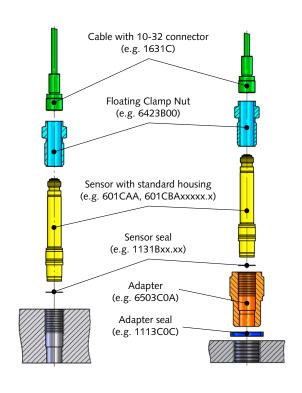

Direct Mounting

- Flush mounting
- · Complex drilling with special tool
- Min. structural influences on pressure measurement (mechanical decoupling)
- Ideal for close matrix alignment of sensors

Type 6503CxA Adapter

- M10 and 3/8-24 UNF
- Stainless steel (1.4542+AT)
- Flush mounting
- Max. Pressure 1 000 bar (14 500 psi)

Type 6503CxD Adapter


- M10 and 3/8-24 UNF
- Ground Isolating
- PEEK GF30 (glass fiber reinforced high • Recessed mounting performance plastic)
- · Max. Pressure 100 bar (1 450 psi)
- Max. temperature 100°C (212°F)

Type 6507BxA Adapter

- M3 and 5-40 UNC
- Stainless steel (1.4542+AT)
- Max. Pressure 300 bar (4 350 psi)

Type 6503C3A Adapter

- 1/8-27 NPTF
- Stainless steel (1.4542+AT)
- · Almost flush mounting
- Max. Pressure 1 000 bar (14 500 psi)

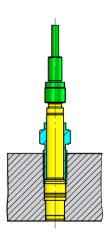









Page 3/7




measure, analyze, innovate,

Mounting (sensors with short housing)

Sensors with charge output (PE) are also available with short housing. For the mounting of these sensors a connector extender of Type 6482A is required. This mounting form is mostly only used where mechanical structures cannot be weakened.

Connector extenders are made to order and are therefore not stock items (unlike floating clamp nuts of Type 6423B). Customers can choose between three different connectors, two different threads and a variable length (see ordering key).

Please note that for a reliable and accurate pressure measurement a precise machining of the mounting hole with special reamers and taps is required (same as for direct mounting, see previous datasheet page). For details on mounting hole fabrication please check the manual. All connector extenders are available for download as 3D CAD files from Kistler's webpage.

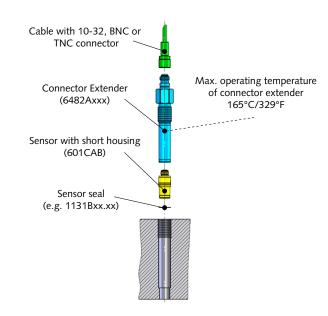

10-32 connector

Small coaxial 10-32 connectors are widely (bayonet lock) is used in the sensor industry and therefore comes with a wide range of high impedance cable options. The small size further allows for sealing the sensor connector with mass as well the difthermo shrink sleeves. Attention needs to be payed to cleanliness of these small connectors.


BNC connector

The BNC connector much bigger and therefor sturdier and less sensitive to contaminations than the widely used 10-32 connector. It's large dimensions and big ficulty to be sealed might however be a criterion for exclusion in some applications.

TNC connector

The TNC connector (thread lock) has about the same size, and offers the same advantages and disadvantages, as the BNC connector. Thanks to the thread lock a good sealing against exterior influences is achieved and is therefore the preferred choice when conducting tests outside a laboratory environment.


Ordering key (connector extender)

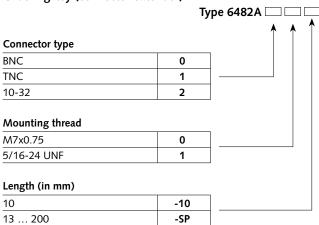

Ordering example

6482A with BNC, M7 thread, 10 mm length 6482A with TNC, M7 thread, 15 mm length 6482A with 10-32, UNF thread, 125 mm length

Type 6482A00-10 6482A10-SP15 6482A21-SP125

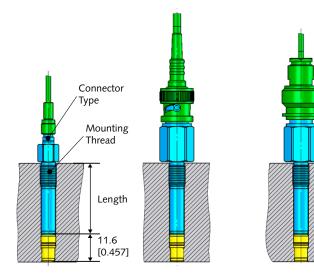





measure, analyze, innovate,


Waterproof solution (IP68)

For pressure sensors subject to water splashes or even used under water the IP68 rated cable Type 1983A shall be used. The Type 1983A cable, made of FKM rubber, comes with a vulcanized 10-32 connector and is only compatible to pressure sensors with a standard housing.

The Type 1983A cable can be screwed like any other standard cable, or optionally even be welded, to the pressure sensor. Welding, instead of screwing, the cable connector to the sensor offers protection against detachment of the cable in case of strong vibrations. Requirements to weld the connector to the sensor need to be stated at the time of order (see below ordering keys).

Both, screwed and welded, solutions have successfully been qualified for IP68 rating in water with pressures ranging from vacuum to 16 bar.


Ordering key (PE sensor with welded 1983A cable)

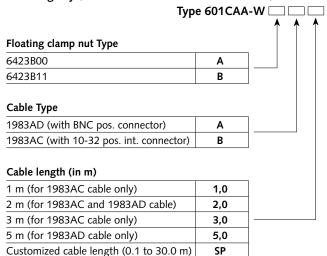

Ordering example

601CAA with 6423B00 and 2 m 1983AD cable 601CAA with 6423B00 and 6 m 1983AD cable 601CAA with 6423B11 and 0.5 m 1983AC cable

601CAA-WAA2,0 601CAA-WAASP6,0 601CAA-WBBSP0,5

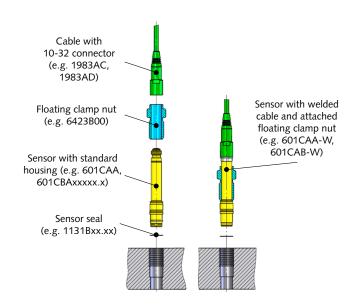

Ordering key (IEPE sensor with welded 1983A cable)

| Type 60° | 1CBA-W | □ - □ | |
|---|---------|--------------|----------|
| | | ↑ ↑ | ^ |
| IEPE pressure range | | | |
| 1.5 bar / 22 psi | 00001.5 | | |
| 3.5 bar / 50 psi | 00003.5 |] | |
| 7 bar / 100 psi | 00007.0 | | |
| 14 bar / 200 psi | 00014.0 |]_ | |
| 35 bar / 500 psi | 00035.0 | 1 | |
| 70 bar / 1 000 psi | 00070.0 |] | |
| 250 bar / 3 625 psi | 00250.0 | | |
| 6423B00 6423B11 | A R | | |
| 6423B11 | В | | |
| | | | |
| Cable Type | | | |
| 1983AD (with BNC pos. connector) | Α | | |
| 1983AC (with 10-32 pos. int. connector) | В |] | |
| | | | |
| Cable length (in m) | , | 1 | |
| 1 m (for 1983AC cable only) | 1,0 |] | |
| 2 m (for 1983AC and 1983A cable) | 2,0 |] | |
| 3 m (for 1983AC cable only) | 3,0 | | |
| 5 m (for 1983AD cable only) | 5,0 | | |
| Customized cable length (0.1 to 30.0 m) | SP | | |

Ordering example

601CBA00001.5 with 6423B00 and 2 m 1983AD cable

601CBA00007.0 with 6423B00 and 6 m 1983AD cable

601CBA00250.0 with 6423B11 and 7 m 1983AC cable

Type

601CBA-W00001.5-AA2,0


601CBA-W00007.0-AASP6,0

601CBA-W00007.0-BBSP7,0



measure. analyze. innovate.

Sensor and seal

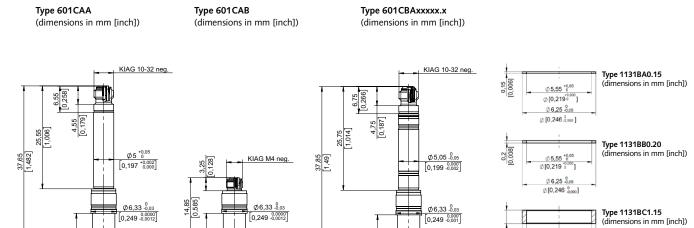


Ø 5,55 -0,015

0,236

Floating clamp nut


Type 6423B00 (dimensions in mm)

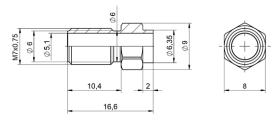

Ø5,55 -0,015 [0,219 -0,0006]

Type 6423B11 (dimensions in inch)

Ø5,55 -0,015

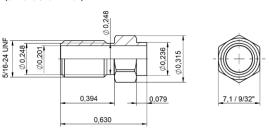


Ø 5,55 +0,05

Ø 6.25 -0.05

Ø [0,246 0,000]

Ø [0,219

Adapter

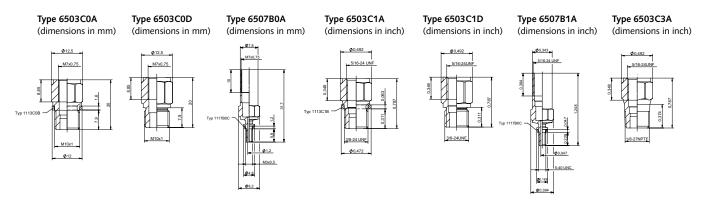

Note: Mounting holes, tightening torques and more can be found in the instruction manual.



3D CAD data can be downloaded free of charge from www.kistler.com/cad-catalog



measure. analyze. innovate.

| Accessories (included) | Type/ArtNo. | Ordering key (sen |
|---|-------------|---|
| • Sensor seal copper (5 pcs.) | 1131BA0.15 | |
| Accessories (optional) | Type/ArtNo. | Output signal |
| Sensor seal copper (100 pcs) | 1131BA0.15 | Charge (PE) |
| Sensor seal nickel (100 pcs) | 1131BB0.20 | Voltage (IEPE) |
| Floating clamp nut M7x0.75 | 6423B00 | |
| Floating clamp nut 5/16-24-UNF | 6423B11 | Housing |
| Adapter M10x1¹⁾ | 6503C0A | Standard housing (PE |
| Adapter seal (S.S. / 25 pcs) for 6503C0A | 1113C0B | Short housing (only F |
| Adapter seal (Cu / 25 pcs) for 6503C0A | 1113C0C | |
| Adapter 3/8-24-UNF¹⁾ | 6503C1A | Pressure range (only |
| Adapter seal (S.S. / 25 pcs) for 6503C1A | 1113C1B | 1.5 bar / 22 psi |
| Adapter seal (Cu / 25 pcs) for 6503C1A | 1113C1C | 3.5 bar / 50 psi |
| Adapter M3x0.5¹⁾ | 6507B0A | 7 bar / 100 psi |
| Adapter 5-40 UNC¹⁾ | 6507B1A | 14 bar / 200 psi |
| Adapter seal for 6507BxA | 1117B0C | 35 bar / 500 psi |
| Lubrication grease (Adapter) | 1063 | 70 bar / 1 000 psi |
| Adapter M10x1 (ground isolated) | 6503C0D | 250 bar / 3 625 psi |
| Adapter 3/8-24 UNF (ground isolated) | 6503C1D | |
| Adapter 1/8-27 NPTF | 6503C3A | Ordering example |
| Connector extender (configurable product) | 6482A | PE sensor with standa PE sensor with short h |
| Extraction tool | 1311 | IEPE sensor (250 bar/3 |
| Dummy sensor (standard housing) | 6487AA | · |
| Dummy sensor (short housing) | 6487AB | |
| Step reamer (SC H7 Ø6.35/Ø5.58) | 1331C | |
| Thread cutter M7x0.75 | 1351A0 | |
| Thread cutter 5/16-24 UNF | 1351A1 | |
| RTV tool | 1300A195 | |
| RTV seal (S.S. / 25 pcs) | 1131BC1.15 | |

 $^{^{\}rm 1)} \, All$ of the adapters are delivered with 1 pc. of each adapter seal type and 1 pc. lubrication grease Type 1063 (except adapters Type 6503C0D, 6503C1D, 6503C3A).

Ordering key (sensor)

| , , , , , , , , , , , , , , , , , , , | | |
|---------------------------------------|---------|-----------------|
| | | Гуре 601С 🗀 🗀 I |
| Output signal | | \uparrow |
| Charge (PE) | Α | |
| Voltage (IEPE) | В | |
| Housing | | |
| Standard housing (PE and IEPE) | Α |] |
| Short housing (only PE) | В | |
| Pressure range (only IEPE) | | _ |
| 1.5 bar / 22 psi | 00001.5 | |
| 3.5 bar / 50 psi | 00003.5 | |
| 7 bar / 100 psi | 00007.0 | |
| 14 bar / 200 psi | 00014.0 | |
| 35 bar / 500 psi | 00035.0 | |
| 70 bar / 1 000 psi | 00070.0 | |
| | | |

| Ordering example | Туре |
|---------------------------------|---------------|
| PE sensor with standard housing | 601CAA |
| PE sensor with short housing | 601CAB |
| IEPE sensor (250 bar/3 625 psi) | 601CBA00250.0 |

00250.0